

PLANNING AND TRANSPORTATION COMMITTEE REPORT

Points to Note:

- There are 14 Public Lifts/Escalators in the City of London estate. This is a report by exception, and hence, only the five listed lifts/escalators that suffered breakdown within the reporting period are shown within this report.
- The report was created on 30th August 2016 and subsequently since this time the public lifts or escalators could have been brought back into service or experienced further breakdowns which will be conveyed in the next report.

Location And Age	Status as of 30/08/2016	% of time in service between 13/07/2016 And 30/08/2016	Number of times reported between 13/07/2016 And 30/08/2016	Period of time Not in Use between 13/07/2016 And 30/08/2016	Comments Where the service is less than 95%
Little Britain Modernised 2007 SC6458967	IN SERVICE	62.2%	1	436 hrs.	1. 08/08/2016 - Engineer attended site and found car doors not closing and lift stuck between floors. Upon investigation the car door shoes had become twisted and required replacing. Parts ordered with return visit on the 26/08/2016 where engineer replaced faulty part, tested and left in service. (436 hrs)
London Wall (No.1) Lift Eastern Pavilion2003 SC6458964	IN SERVICE	91.5%	1	96 hrs.	1. 15/07/2016 - Engineer attended site and released trapped passengers and identified a fault with a blocked valve which required a hydraulic specialist. Return visit on the 19/07/2016 which rectified the problem, lift tested and left in service. (96 hours)
London Wall (No.1) Escalator (UP) 2003 SC6458959	OUT OF SERVICE	52.0%	2	542 hrs.	1. 16/07/2016 - Engineer attended site and found escalator out of service but couldn't identify fault. Return visit from specialist technician on the 18/07/16 where the escalator was reset and left in service. (51 hours) 2. 09/08/2016 – Engineer attended site and found escalator handrail off track. New

PLANNING AND TRANSPORTATION COMMITTEE REPORT

Location And Age	Status as of 30/08/2016	% of time in service between 13/07/2016 And 30/08/2016	Number of times reported between 13/07/2016 And 30/08/2016	Period of time Not in Use between 13/07/2016 And 30/08/2016	Comments Where the service is less than 95%
					handrail required, repair incomplete at time of report. (491 hours)
Millennium Bridge Inclinators 2012 SC6459245	OUT OF SERVICE	92.0%	5	92 hrs.	1. 22/07/2016 - Engineer attended site and found lowest level lock not matching, adjustments to lock release made. Tested and left in service (4 hours) 2. 28/07/2016 - Engineer attended site and found lowest level lock not matching, adjustments to lock release made. Tested and left in service (6 hours) 3. 17/08/2016 – Engineer attended site and found top floor lock assembly binding and not matching fully. Adjustments made, tested and left in service (3 hours) 4. 23/08/2016 - Engineer attended site and found lowest level lock not matching, adjustments to lock release made. Tested and left in service (17 hours) 5. 28/08/2016 - Engineer attended site and doors not opening at top level. Parts required and repair incomplete at time of report time. (62 hours)
Tower Bridge SC6459244	IN SERVICE	87.0%	5	136 hrs.	1. 08/08/2016 - Engineer attended site and found lift stuck on the lower level. Adjusted bottom lock. Tested and left in service. (4 Hours) 2. 10/08/2016 - Engineer attended site and found fault with the magnetic switch, parts

PLANNING AND TRANSPORTATION COMMITTEE REPORT

Location And Age	Status as of 30/08/2016	% of time in service between 13/07/2016 And 30/08/2016	Number of times reported between 13/07/2016 And 30/08/2016	Period of time Not in Use between 13/07/2016 And 30/08/2016	Comments Where the service is less than 95%
					<p>required. Return visit on 15/08/2016 where parts fitted, tested and left in service (97 hours)</p> <p>3. 16/08/2016 - Engineer attended site and found a fault with the magnets, adjustments made, tested and left in service. (4 hours)</p> <p>4. 17/08/2016 - Engineer attended site and found lift stopping at 30mm below bottom floor level. Adjustments made, tested and left in service. (27 hours)</p> <p>5. 22/08/2016 – Engineer attended site and found loose wire in limit switch, repaired, tested and left in service. (4 hours)</p>